

splices whose insulating quality is equal to that of the cable are permitted.

(3) When it becomes necessary to connect or splice lengths of cable one to another, substantial insulated connectors of a capacity at least equivalent to that of the cable shall be used. If connections are effected by means of cable lugs, they shall be securely fastened together to give good electrical contact, and the exposed metal parts of the lugs shall be completely insulated.

(4) Cables in poor repair shall not be used. When a cable other than the cable lead referred to in paragraph (b)(2) of this section becomes worn to the extent of exposing bare conductors, the portion thus exposed shall be protected by means of rubber and friction tapes or other equivalent insulation.

(c) *Ground returns and machine grounding.* (1) A ground return cable shall have a safe current carrying capacity equal to or exceeding the specified maximum output capacity of the arc welding or cutting unit which it services. When a single ground return cable services more than one unit, its safe current carrying capacity shall equal or exceed the total specified maximum output capacities of all the units which it services.

(2) Structures or pipe lines, except pipe lines containing gases of flammable liquids or conduits containing electrical circuits, may be used as part of the ground return circuit, provided that the pipe or structure has a current carrying capacity equal to that required by paragraph (c)(1) of this section.

(3) When a structure or pipe line is employed as a ground return circuit, it shall be determined that the required electrical contact exists at all joints. The generation of an arc, sparks or heat at any point shall cause rejection of the structure as a ground circuit.

(4) When a structure or pipe line is continuously employed as a ground return circuit, all joints shall be bonded, and periodic inspections shall be conducted to ensure that no condition of electrolysis or fire hazard exists by virtue of such use.

(5) The frames of all arc welding and cutting machines shall be grounded either through a third wire in the cable

containing the circuit conductor or through a separate wire which is grounded at the source of the current. Grounding circuits, other than by means of the vessel's structure, shall be checked to ensure that the circuit between the ground and the grounded power conductor has resistance low enough to permit sufficient current to flow to cause the fuse or circuit breaker to interrupt the current.

(6) All ground connections shall be inspected to ensure that they are mechanically strong and electrically adequate for the required current.

(d) *Operating instructions.* Employers shall instruct employees in the safe means of arc welding and cutting as follows:

(1) When electrode holders are to be left unattended, the electrodes shall be removed and the holders shall be so placed or protected that they cannot make electrical contact with employees or conducting objects.

(2) Hot electrode holders shall not be dipped in water, since to do so may expose the arc welder or cutter to electric shock.

(3) When the arc welder or cutter has occasion to leave his work or to stop work for any appreciable length of time, or when the arc welding or cutting machine is to be moved, the power supply switch to the equipment shall be opened.

(4) Any faulty or defective equipment shall be reported to the supervisor.

(e) *Shielding.* Whenever practicable, all arc welding and cutting operations shall be shielded by noncombustible or flame-proof screens which will protect employees and other persons working in the vicinity from the direct rays of the arc.

§ 1915.57 Uses of fissionable material in ship repairing and shipbuilding.

The provisions of this section apply to ship repairing and shipbuilding only.

(a) In activities involving the use of and exposure to sources of ionizing radiation not only on conventionally powered but also on nuclear powered vessels, the applicable provisions of the Nuclear Regulatory Commission's

§ 1915.71

29 CFR Ch. XVII (7–1–06 Edition)

Standards for Protection Against Radiation (10 CFR part 20), relating to protection against occupational radiation exposure, shall apply.

(b) Any activity which involves the use of radiocative material, whether or not under license from the Nuclear Regulatory Commission, shall be performed by competent persons specially trained in the proper and safe operation of such equipment. In the case of materials used under Commission license, only persons actually licensed, or competent persons under direction and supervision of the licensee, shall perform such work.

Subpart E—Scaffolds, Ladders and Other Working Surfaces

§ 1915.71 Scaffolds or staging.

(a) *Scope and application.* The provisions of this section shall apply to all ship repairing, shipbuilding and shipbreaking operations except that paragraphs (b)(8) through (b)(10) and paragraphs (c) through (f) of this section shall only apply to ship repairing and shipbuilding operations and shall not apply to shipbreaking.

(b) *General requirements.* (1) All scaffolds and their supports whether of lumber, steel or other material, shall be capable of supporting the load they are designed to carry with a safety factor of not less than four (4).

(2) All lumber used in the construction of scaffolds shall be spruce, fir, long leaf yellow pine, Oregon pine or wood of equal strength. The use of hemlock, short leaf yellow pine, or short fiber lumber is prohibited.

(3) Lumber dimensions as given in this subpart are nominal except where given in fractions of an inch.

(4) All lumber used in the construction of scaffolds shall be sound, straight-grained, free from cross grain, shakes and large, loose or dead knots. It shall also be free from dry rot, large checks, worm holes or other defects which impair its strength or durability.

(5) Scaffolds shall be maintained in a safe and secure condition. Any component of the scaffold which is broken, burned or otherwise defective shall be replaced.

(6) Barrels, boxes, cans, loose bricks, or other unstable objects shall not be used as working platforms or for the support of planking intended as scaffolds or working platforms.

(7) No scaffold shall be erected, moved, dismantled or altered except under the supervision of competent persons.

(8) No welding, burning, riveting or open flame work shall be performed on any staging suspended by means of fiber rope.

(9) Lifting bridles on working platforms suspended from cranes shall consist of four legs so attached that the stability of the platform is assured.

(10) Unless the crane hook has a safety latch or is moused, the lifting bridles on working platforms suspended from cranes shall be attached by shackles to the lower lifting block or other positive means shall be taken to prevent them from becoming accidentally disengaged from the crane hook.

(c) *Independent pole wood scaffolds.* (1) All pole uprights shall be set plump. Poles shall rest on a foundation of sufficient size and strength to distribute the load and to prevent displacement.

(2) In light-duty scaffolds, not more than 24 feet in height, poles may be spliced by overlapping the ends not less than 4 feet and securely nailing them together. A substantial cleat shall be nailed to the lower section to form a support for the upper section except when bolted connections are used.

(3) All other poles to be spliced shall be squared at the ends of each splice, abutted, and rigidly fastened together by not less than two cleats securely nailed or bolted thereto. Each cleat shall overlap each pole end by at least 24 inches and shall have a width equal to the face of the pole to which it is attached. The combined cross sectional area of the cleats shall be not less than the cross sectional area of the pole.

(4) Ledgers shall extend over two consecutive pole spaces and shall overlap the poles at each end by not less than 4 inches. They shall be left in position to brace the poles as the platform is raised with the progress of the work. Ledgers shall be level and shall be securely nailed or bolted to each pole and shall be placed against the inside face of each pole.